




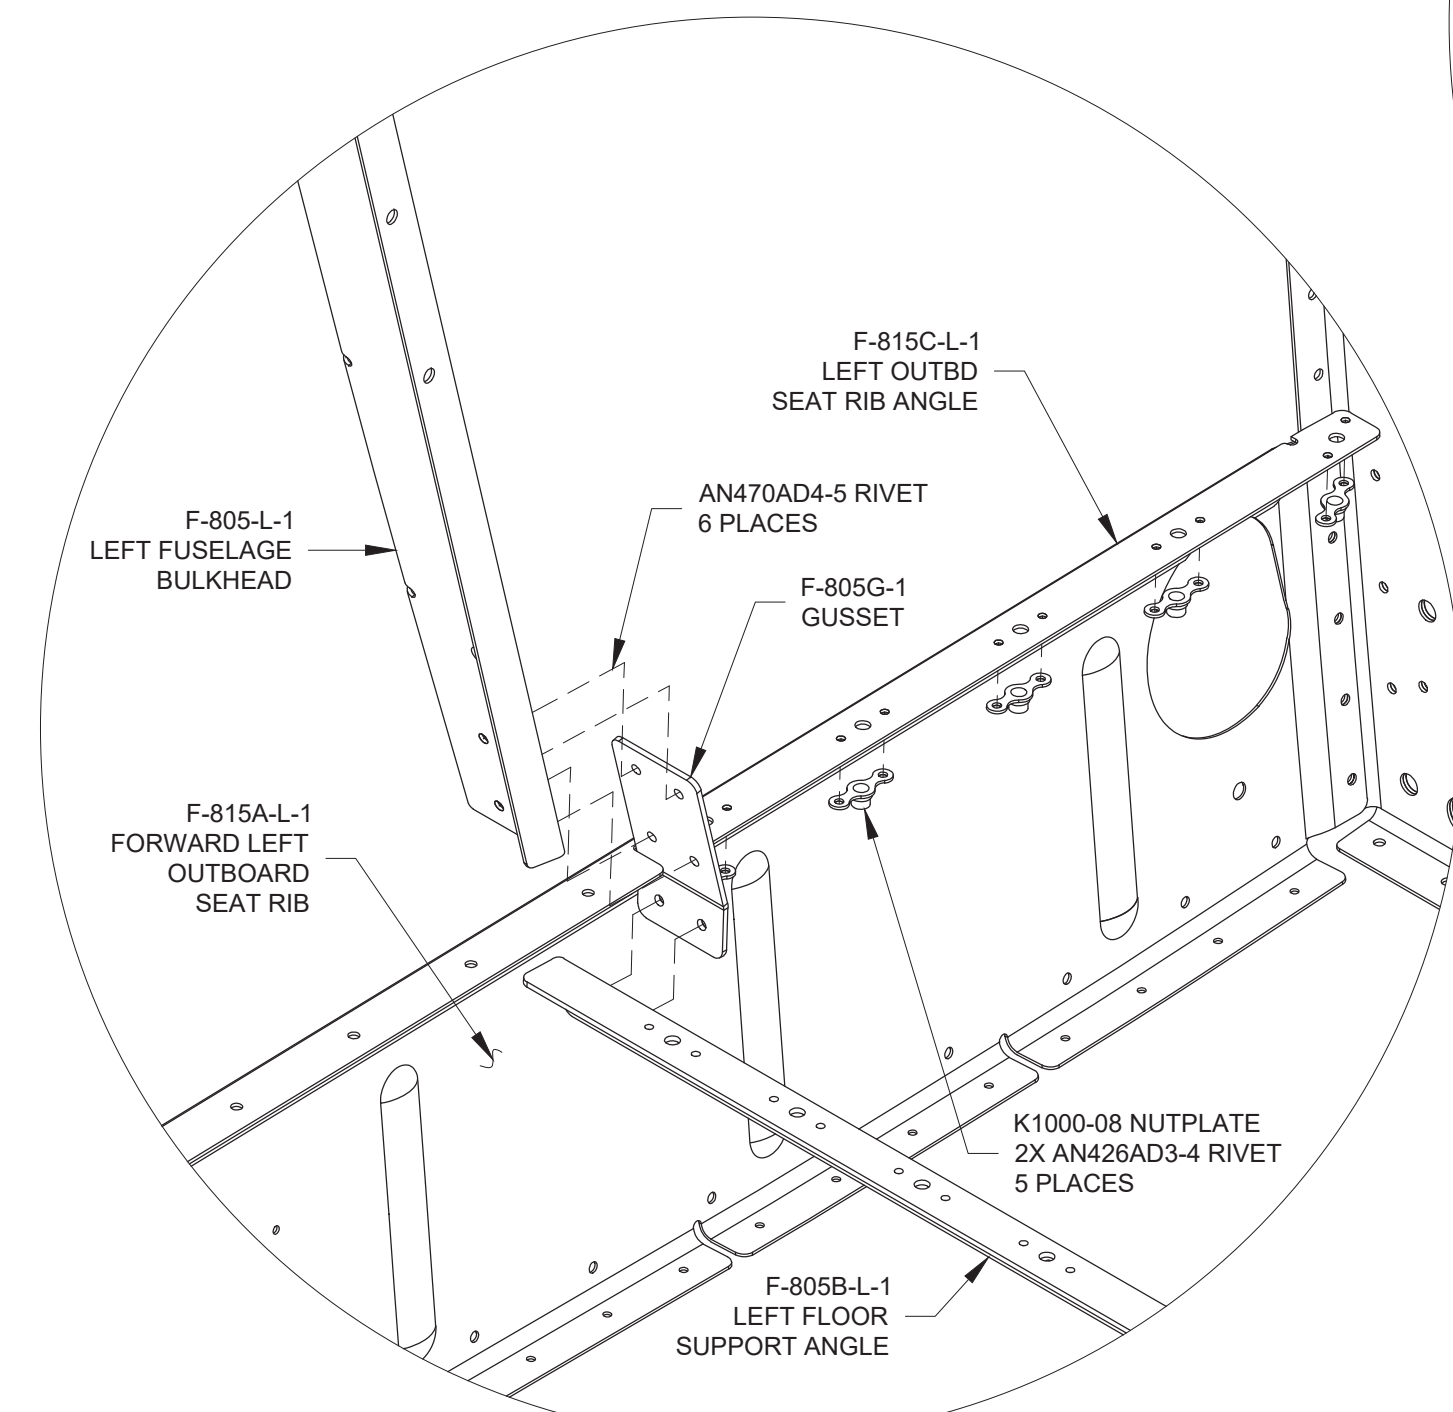


DETAIL B

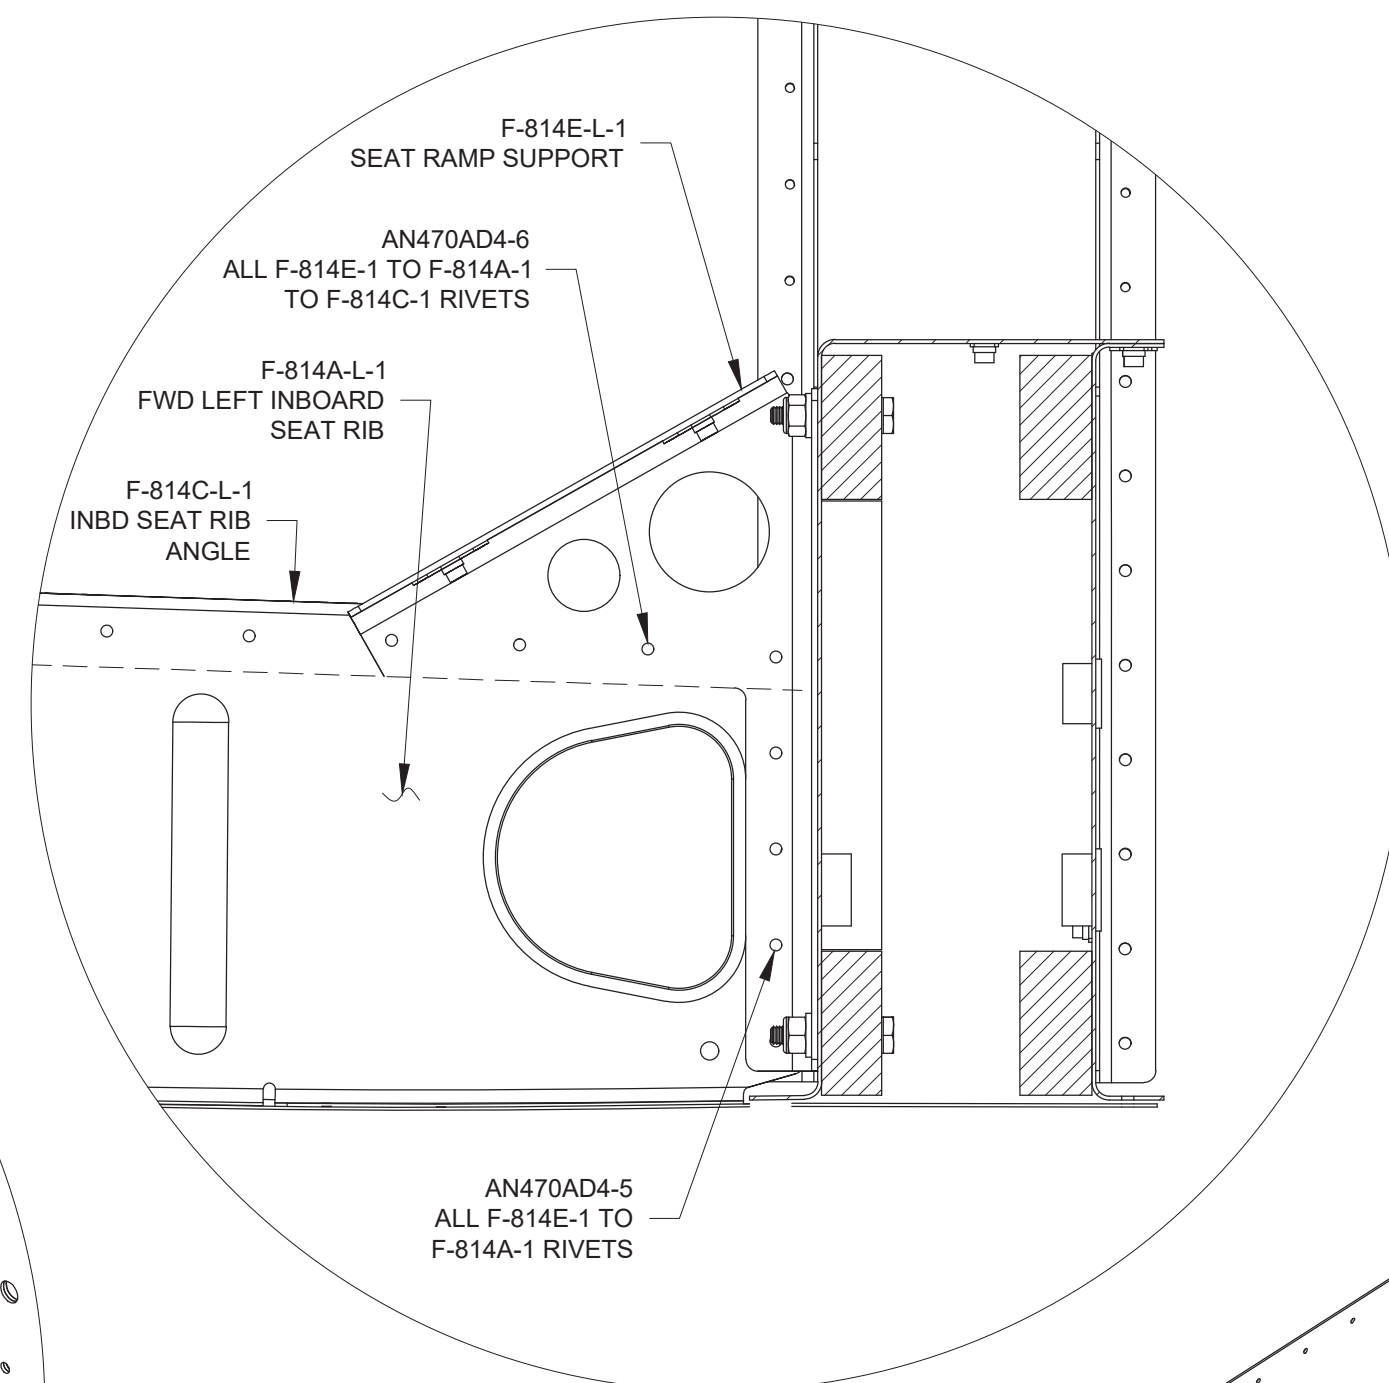


DETAIL C

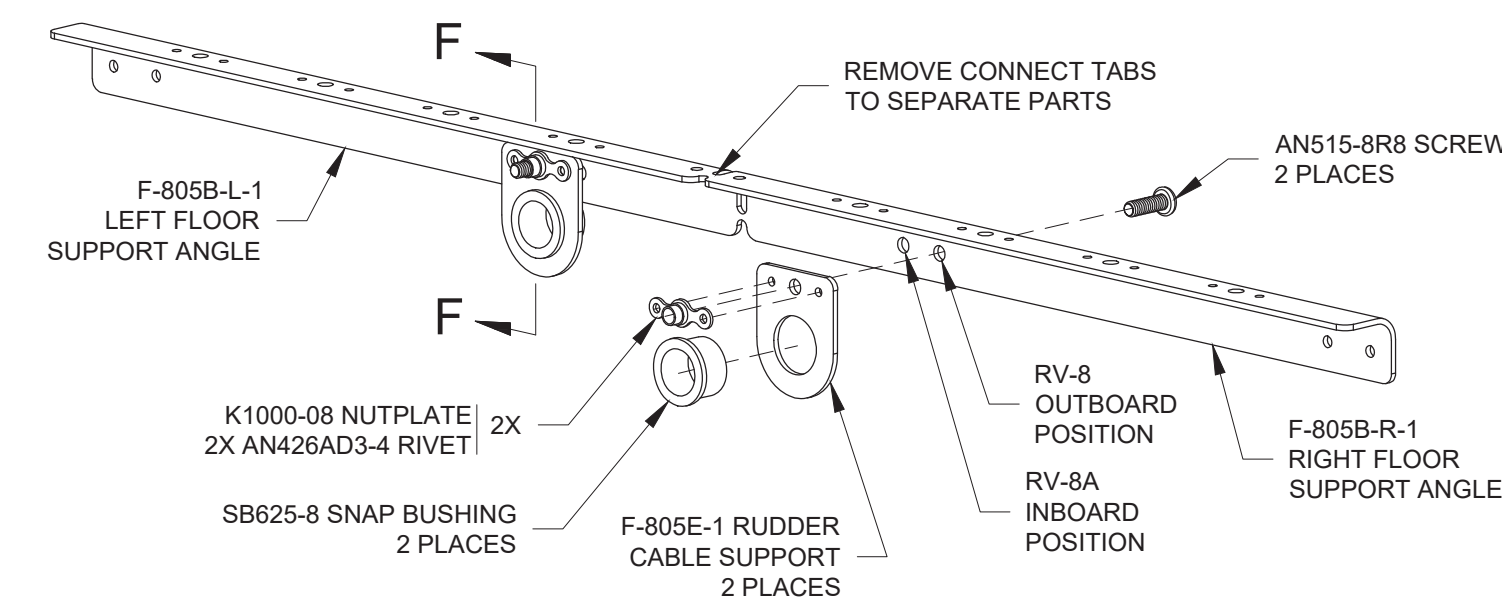


F-805B-1 FLOOR SUPPORT ANGLE DETAIL

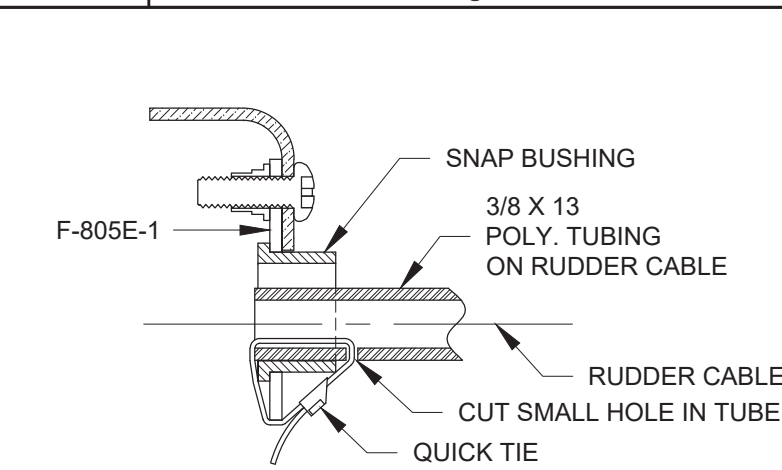

SECTION F-F

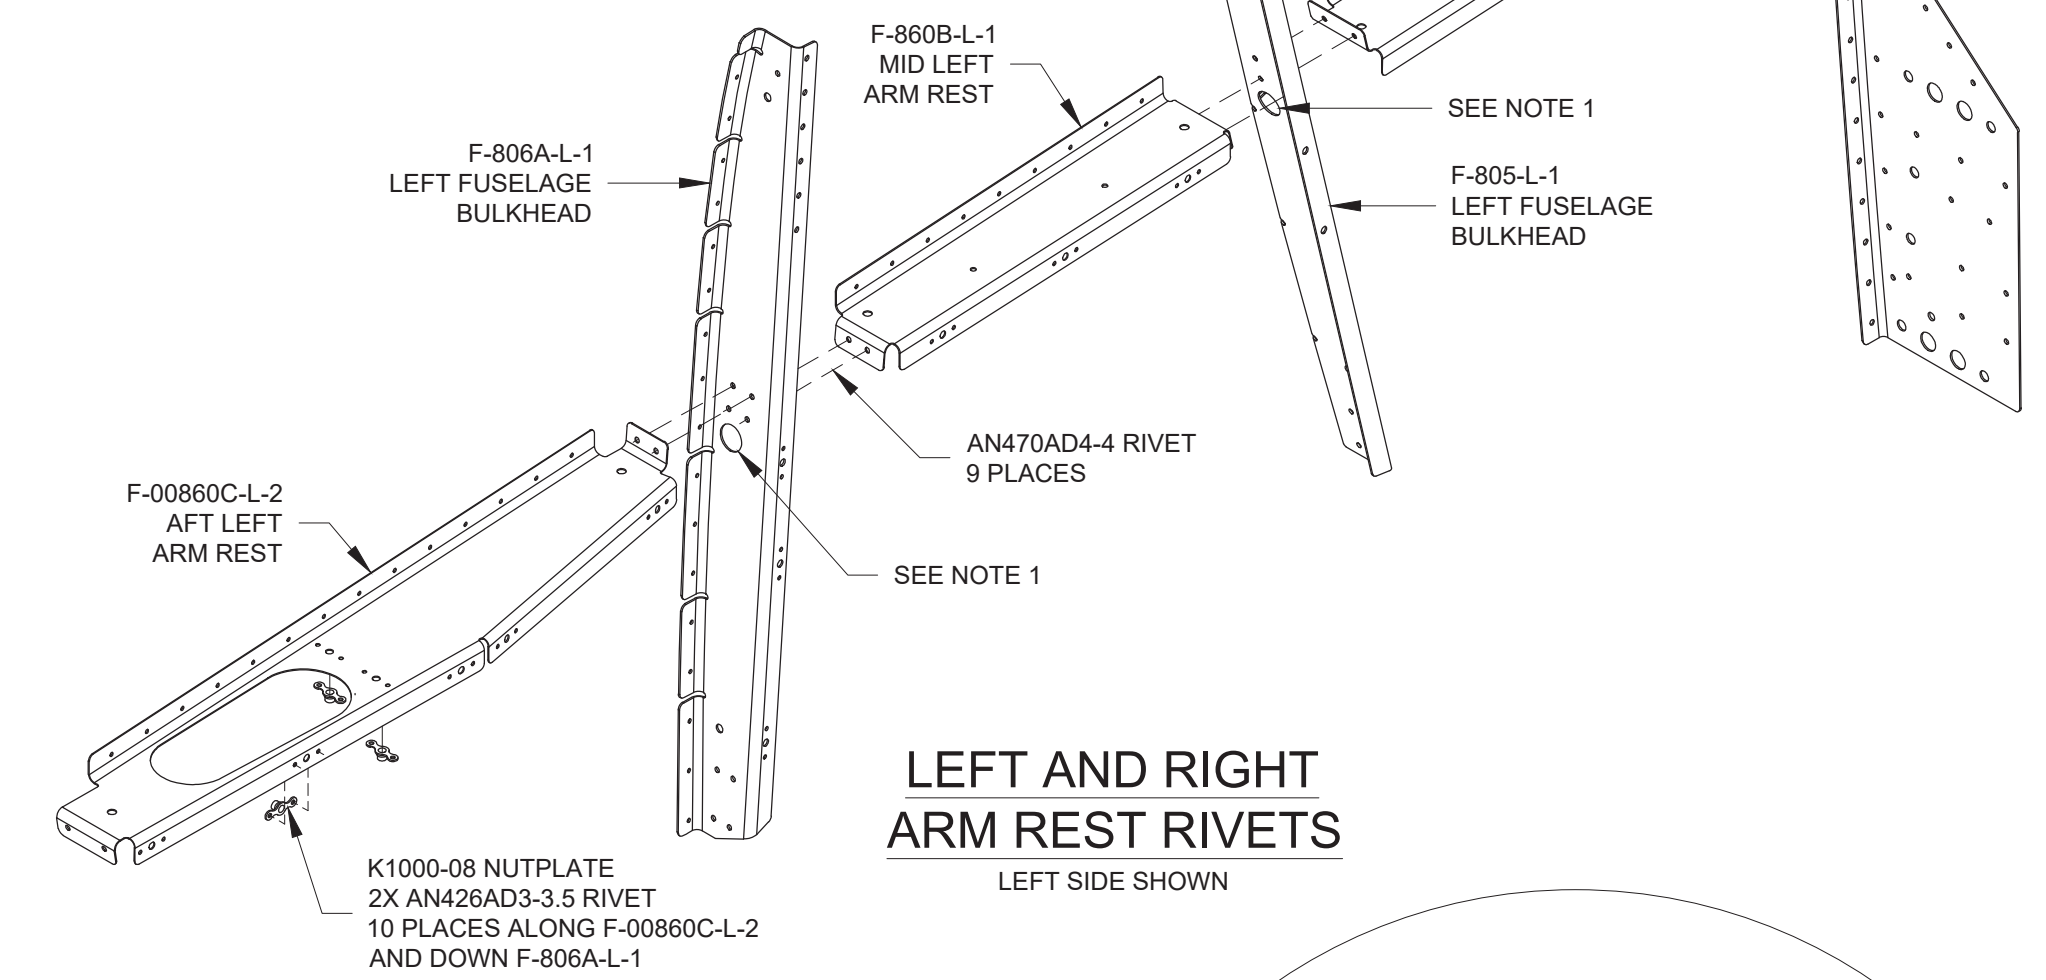
LEFT AND RIGHT
ARM REST RIVETS
LEFT SIDE SHOWN

NOTES:
1. INSTALL SB625-8 SNAP BUSHING FOR ELEVATOR MANUAL TRIM ROUTING

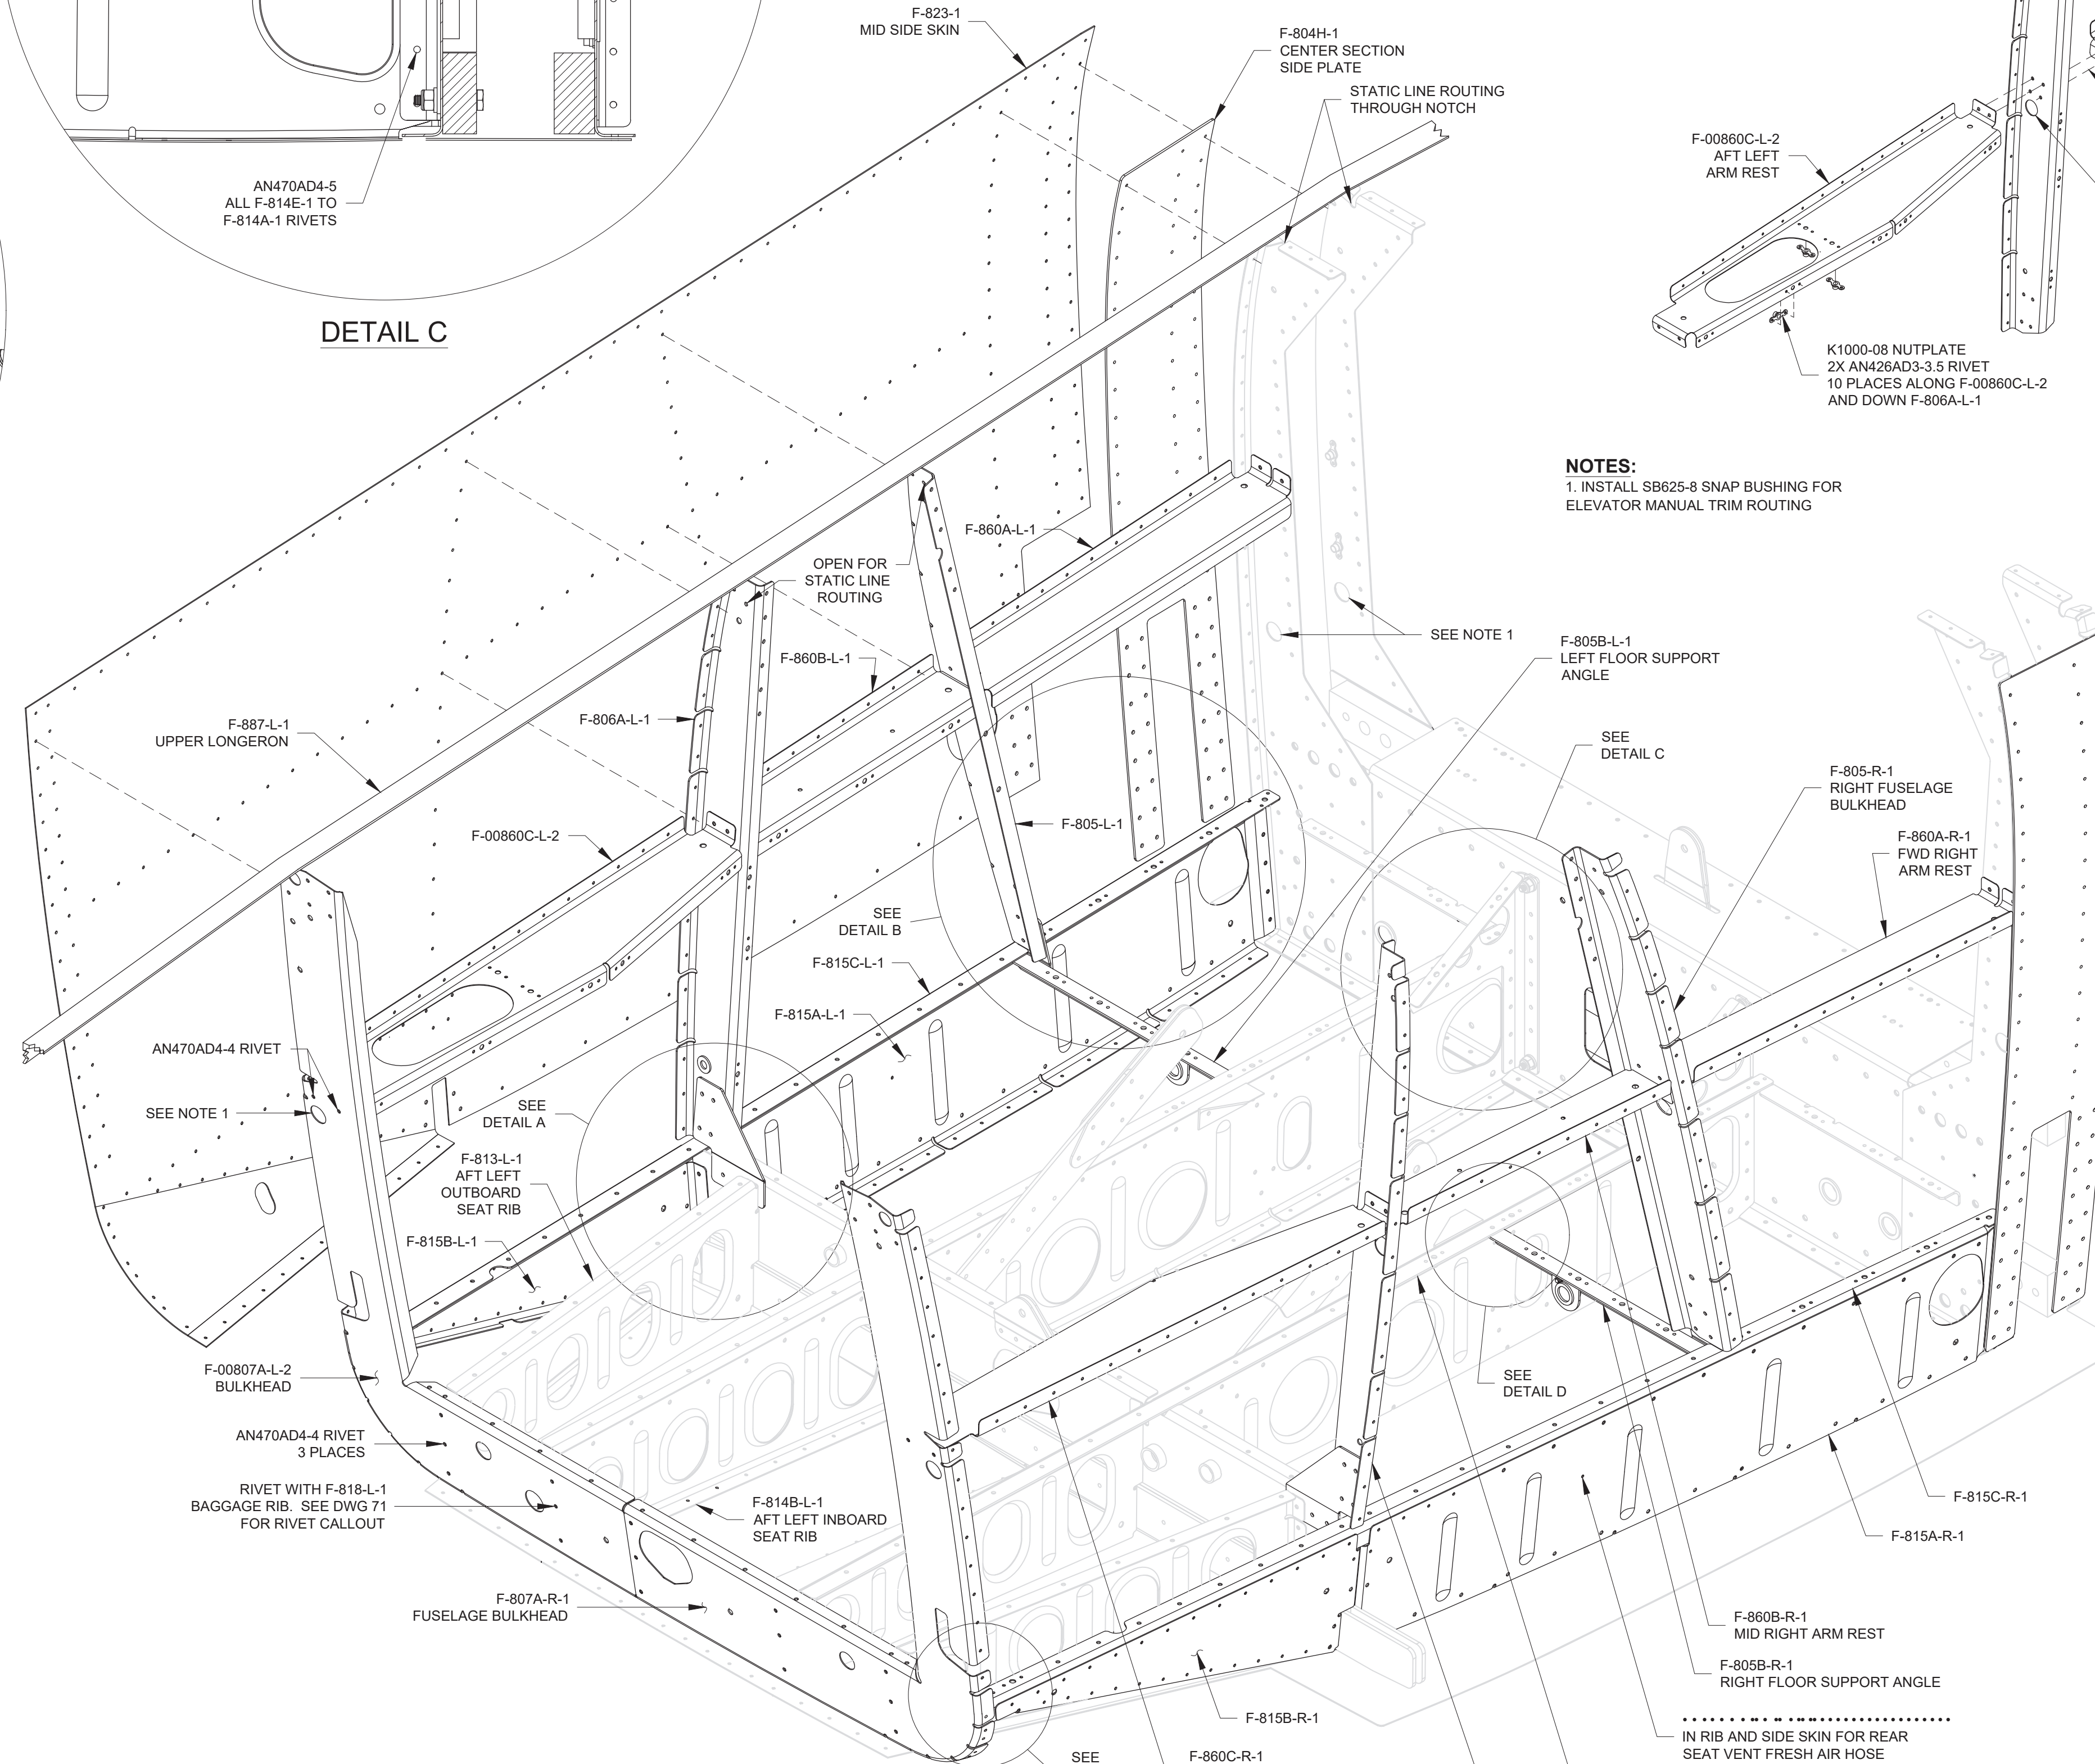


MID FUSE SIDE SKIN AND STRUCTURE


RIVET CALL-OUTS SYMMETRICAL ABOUT AIRPLANE CENTERLINE
SOME PARTS NOT SHOWN FOR CLARITY

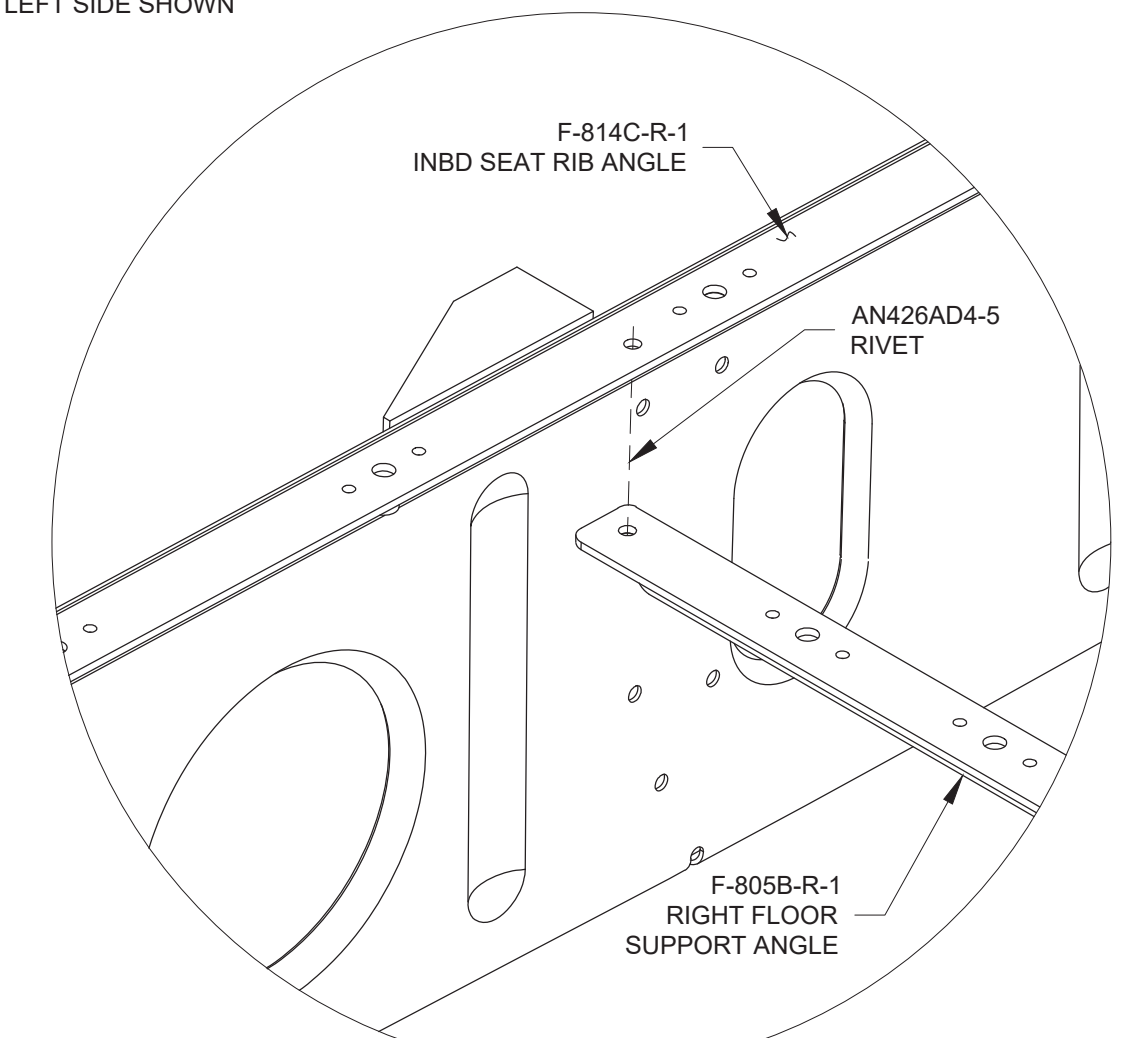

DETAIL D

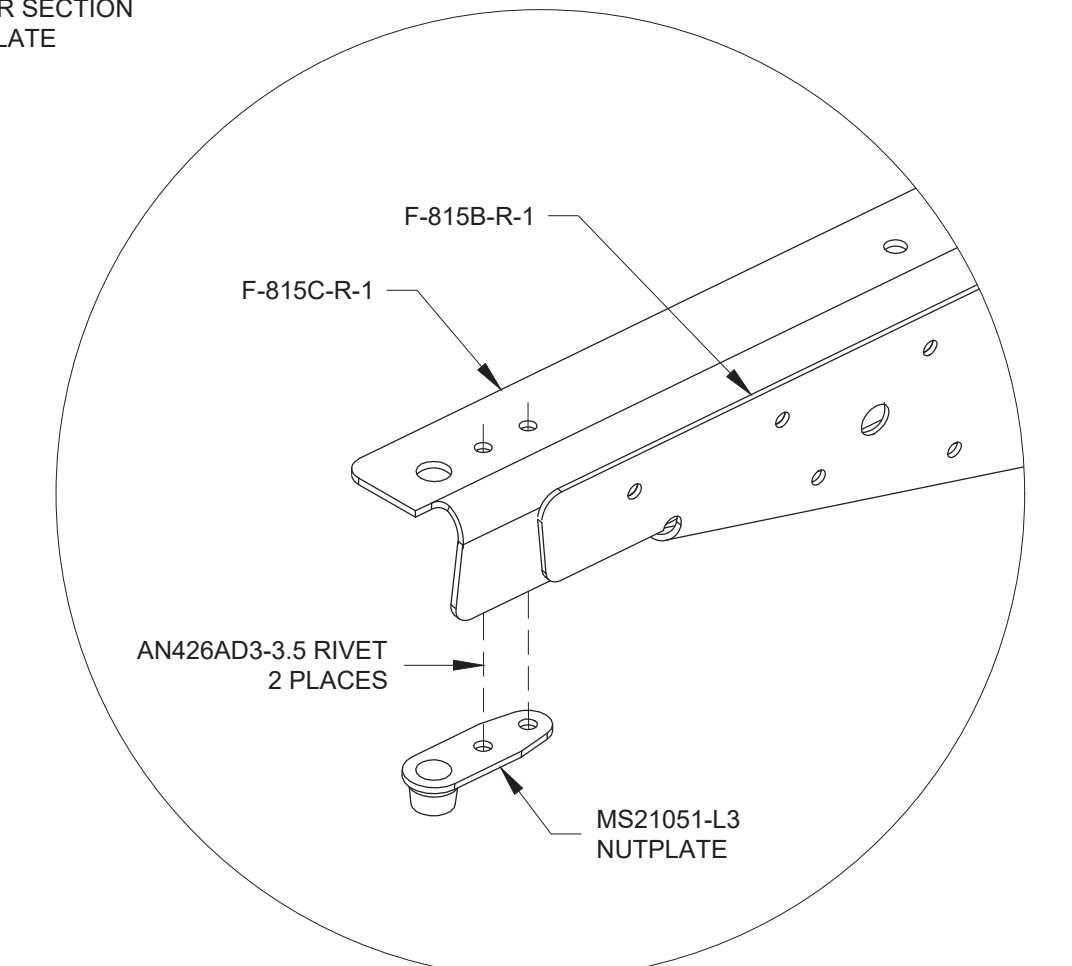


DETAIL E

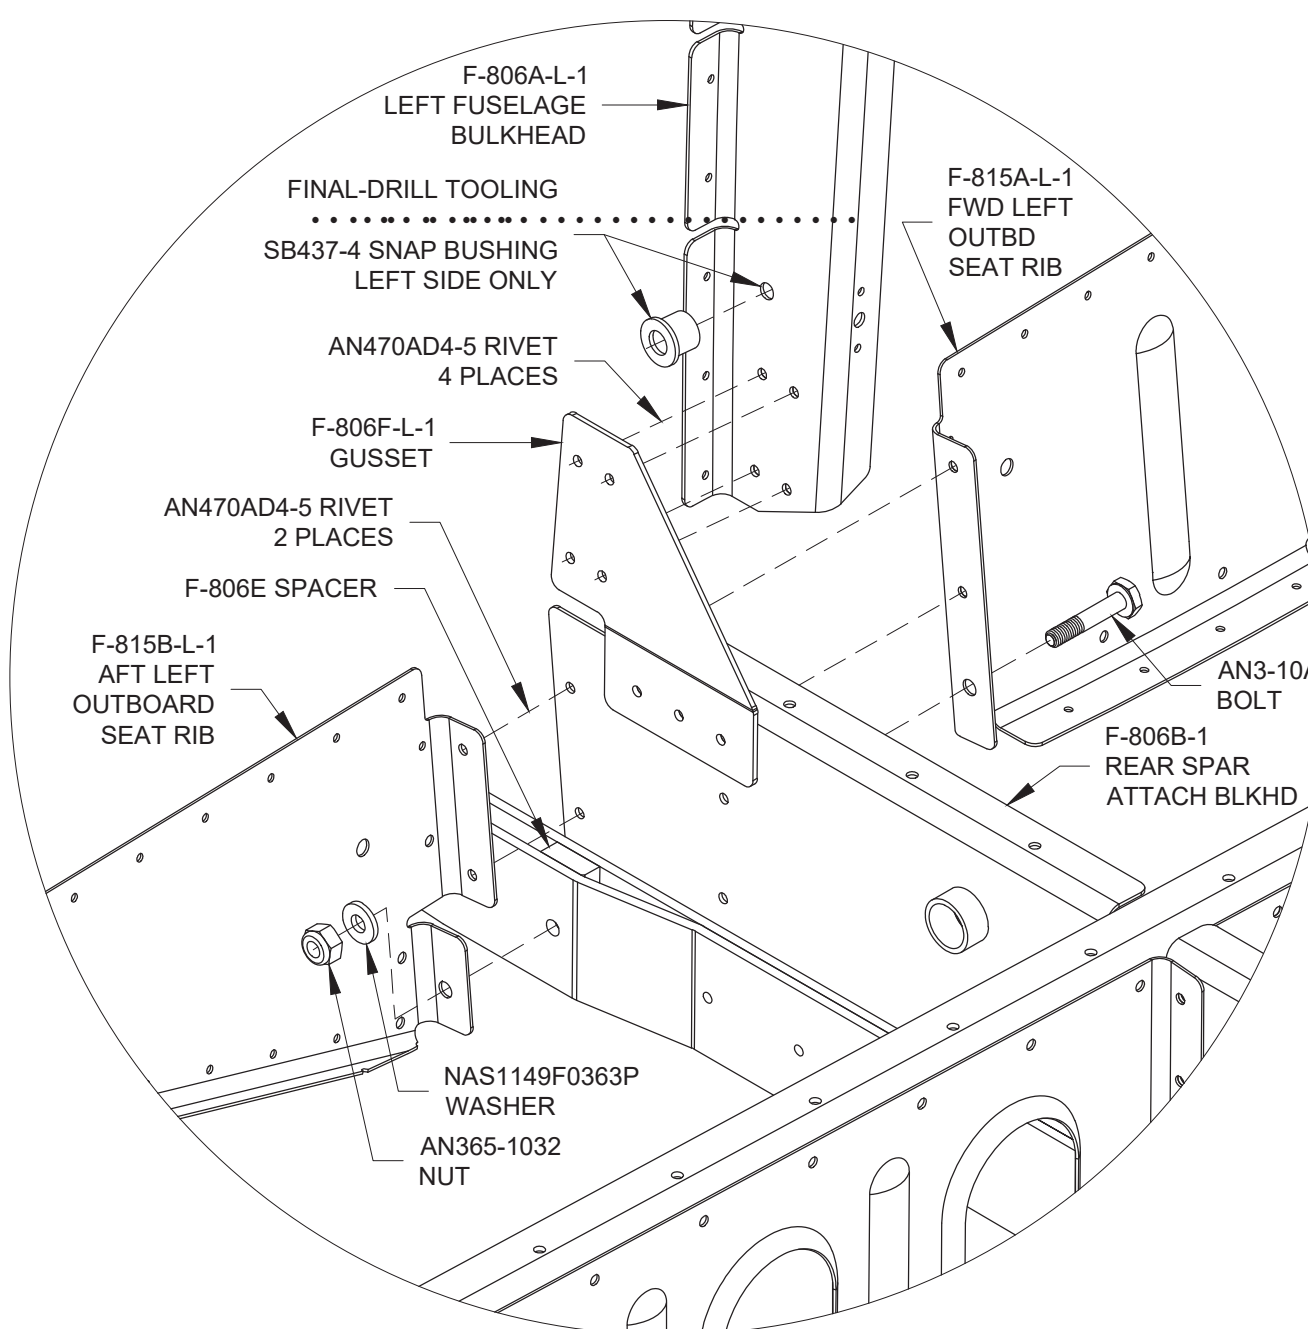

DETAIL A

F-813-L-1 NOT SHOWN FOR CLARITY

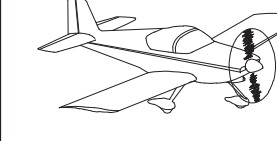R1 F-00807A-L-2 WAS F-807A-L-1, F-00860-L-2 WAS F-860-L-1.		11/15/24
		14401 NE KEIL RD. AURORA, OR 97002 USA
VAN'S AIRCRAFT, INC.		
MID FUSE SIDE SKINS AND STRUCTURE		
DATE: DRAWN: 8/12/05	UNITS: INCHES	RV-8 / 8A
DRAWN BY: MICHAEL SCHWARTZ	TOLERANCES: NONE	SCALE: NONE
(UNLESS OTHERWISE SPECIFIED)	PATH\FILENAME: Q:\RV-8Z-OTHER\PLANS\RV8-69\RV8-69.DWG	D-SIZE ORIGINAL
		DWG 69